


N 418 - N 418.S - N 419 - N 419.S

Bussole con collare complete di gabbie a sfere N 411




A


N 418

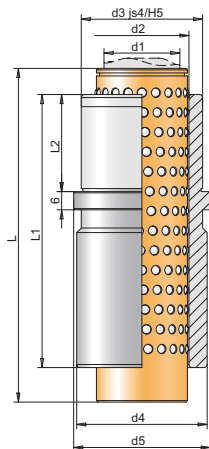


N 418.S

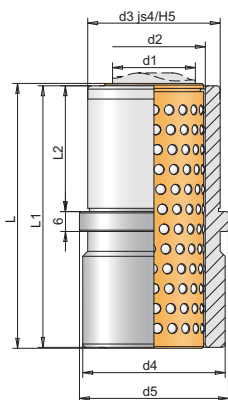

N 419

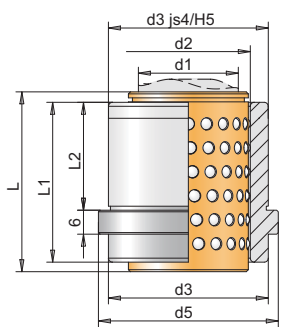

N 419.S

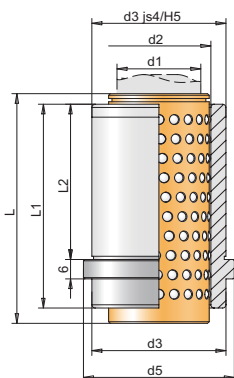

N 418 - N 418.S - N 419 - N 419.S

Bussole: Acciaio da cementazione
Durezza: 62÷64 HRC
Trattamento: Cementazione e tempra
Esecuzione: Rettificate finemente e superfinite
Materiale per sfere: Acciaio C100Cr6 superfinite con grado AAA
Gabbie: Bronzo B14

N 418

d1	19/20	24/25	30/32	38/40	48/50	63
d2	25/26	30/31	38/40	46/48	56/58	71
d3	32	40	48	58	70	85
d4	38	43	51	63	76	94
d5	40	45	54	66	80	95
d6	52	56	64	76	91	106
d7	67,9	71,8	81,7	92,7	106,6	121,5
M	M6	M6	M8	M8	M8	M8
L	95	110	120	140	140	140
L1	80	90	100	112	130	130
L2	28	32	36	40	46	46

N 418.S


d1	19/20	24/25	30/32	38/40	48/50	63
L	71	80	105	105	105	120
L1	66	79	94	94	94	100
L2	30	38	48	48	57	57

N 419

d1	19/20	24/25	30/32	38/40	48/50	63
L	45	45	56	63	80	95
L1	36	40	45	50	80	80
L2	23	27	32	37	67	67

N 419.S

d1	19/20	24/25	30/32	38/40	48/50	63
L	45	71	80	80	105	120
L1	43	63	76	76	96	100
L2	30	48	61	61	78	78

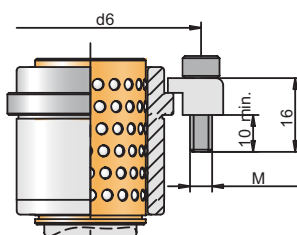

POSIZIONAMENTO STAFFETTE

